PKNB41AB
----------

## Newberry LED Light Pole Kit with Economy Acorn Fixture 4 Inch Diameter Light Pole - Anchor Based

Job:	<b>\</b>		
Job Site: _	State:	Client Name:	
Notes:		Approvals:	Date:

## LIGHT POLE

Pole Shaft: 4 inch round straight aluminum with 0.125" wall thickness.

Seamlessly extruded from 6063-T6 alloy.

Pole Height: Standard pole height is 16 ft. Optional heights are 14, 12, 10

and 8 ft. Custom heights are also available.

Handhole: 2-1/2" X 4" size handhole is located at 18 inches from the base. An aluminum handhole cover with 2 screws is provided. A ground lug with set screw is located near the handhole opening for proper grounding of the pole.

Decorative Base: 2-piece, clamshell style cast aluminum material.

4 stainless steel, tamper-resistant screws are included for attachment.

Attached to the pole with 3 set screws.

Weight: 9 lbs

Anchor Bolts: A set of 4 galvanized steel anchor bolts is provided with each pole assembly. Each anchor bolt includes 2 nuts and 2 washers. Top portion of the anchor bolt is threaded for securing and leveling the pole with the provided nuts and washers. An actual size paper anchor bolt template is provided.

Color: Black powder coat.

Maximum Wind Rating: 100 mph wind zone with 1.3 gust factor.

Warranty: 5 Years.

Foundation Design: Foundation should be designed by an engineer familiar with local soil and wind conditions as well as local code where the pole(s) will be installed.

## **ACORN FIXTURE**


Economy LED Acorn Light Fixture: Textured clear polycarbonate acorn lens is attached to the base with a simple locking mechanism.

The base is made of ABS plastic and includes a medium socket.

Wet location rated.

Weight: 2.5 lbs

LED Power (Watt)	Lumens	Lumens Per Watt	Voltage (Volt)
27	3,900	144	120-277
36	5,400	150	120-277

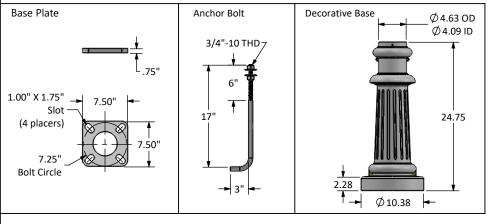

Disclaimer: All dimensions and specifications are subject to change without any notice. Energy Light, Inc. is not responsible for any claims arising from improper loading (what is attached to the light pole), improper use, incorrect foundation design and/or installation.

